

<b>Health Physics</b>	 <b>diamond</b>	<b>Doc No: TDI-HP-LR-0002</b> <b>Issue: 9</b> <b>Date: 04<sup>th</sup> August 2015</b> <b>Page: 1 of 18</b>
Author: RDoull	Reviewed by: SFaruk	Issued on:



## Diamond Light Source

# Local Rules for the Protection of Persons from Ionising Radiations

## Beamlines & Experimental Hall Floor

These Local Rules are important for your safety and well being. All Diamond Light Source personnel, users, visitors and contractors must follow these Local Rules whilst working in the Diamond Controlled and Supervised Radiation Areas. Disciplinary action will be taken against anyone found tampering with the Personnel Safety System or radiation shielding or deliberately failing to follow an effective search procedure.

These Local Rules will be reviewed annually or whenever significant changes are required.

This issue of the Beamlines Local Rules supersedes all previous issues.

<b>Health Physics</b>		<b>Doc No: TDI-HP-LR-0002</b> <b>Issue: 9</b> <b>Date: 04<sup>th</sup> August 2015</b> <b>Page: 2 of 18</b>
Author: RDoull	Reviewed by: SFaruk	Issued on:

**Document Approval:**

Health Physics holds the master copy with all signature of approval.

Name	Position	Sign and date
Trevor Rayment	Science Director (Physical Science)	.....
Dave Stuart	Science Director (Life Science)	.....
Richard Doull	RPA & HP Team Leader	.....
Guy Thomas	Head of Safety, Health and Environment (SHE) Group	.....
Jean Lane	Experimental Hall Manager	.....
Martin Wilson	Principal Personnel Safety Engineer	.....

<h1>Health Physics</h1>		<p>Doc No: TDI-HP-LR-0002  Issue: 9  Date: 04<sup>th</sup> August 2015  Page: 3 of 18</p>
Author: RDoull	Reviewed by: SFaruk	Issued on:

Index	Contents	Page
1.	<a href="#">Introduction</a>	6
2.	<a href="#">Radiation Safety Organisation and Responsibilities</a>	6
3.	<a href="#">Dose Investigation Level</a>	7
4.	<a href="#">Areas to Which these Rules Apply</a>	8
5.	<a href="#">Shielding</a>	8
6.	<a href="#">Personnel Safety System (PSS)</a>	9
7.	<a href="#">Access / Working Instructions</a>	10
8.	<a href="#">Use of Radioactive Sources, Samples and X-ray Generators</a>	12
9.	<a href="#">Incidents, Accidents and Contingency Plans</a>	13
10.	<a href="#">General</a>	13
	Appendix 1 – Names of Nominated People	14
	Appendix 2 – Designation of areas	15
	Appendix 3 – Written System of Work for access to the DLS Controlled Radiation Areas by Non-classified Persons	16
	Appendix 4 – Contingency Plan for Persons Exposed to Radiation within a Hutch	20

<p><b>Health Physics</b></p>	 <p><b>diamond</b></p>	<p><b>Doc No: TDI-HP-LR-0002</b>  <b>Issue: 9</b>  <b>Date: 04<sup>th</sup> August 2015</b>  <b>Page: 4 of 18</b></p>
<p>Author: RDoull</p>	<p>Reviewed by: SFaruk</p>	<p>Issued on:</p>

## 1. Introduction

- 1.1 These Local Rules are a requirement of Regulation 17 (1) of the Ionising Radiations Regulations 1999 (IRR99) and they set out the key arrangements for restricting radiation exposure in and around the Diamond Beamlines. They define the principles and working procedures to be adopted to ensure safe operation of the Diamond Light Source (DLS) beamlines. All Diamond Light Source staff and Users working in the Beamline Controlled or Supervised Radiation Areas must read these Local Rules before entering those areas covered by these Rules. All persons supervising contractors or guiding visitors in the Controlled or Supervised Radiation Areas must ensure that they are familiar with and obey the access conditions described in section 7.
- 1.2 Separate Local Rules are available for the DLS Controlled Radiation Areas not covered by this document, and links to these documents will be found on the Health Physics area of the Diamond Intranet. Written procedures are provided where appropriate for all Supervised Radiation Areas not covered by this document.
- 1.3 These rules cover beamline commissioning and operation.
- 1.4 A glossary of Health Physics terms used in this document can be found on the Health Physics intranet page.

## 2. Radiation Safety Organisation and Responsibilities

- 2.1 The Chief Executive Officer of DLS Ltd has overall responsibility for the health and safety of all staff, users, contractors and visitors at Diamond Light Source. The CEO may delegate authority for certain health and safety functions to other people, however, he may not delegate his responsibility. Safety responsibility then devolves down the management and supervisory chains.
- 2.2 A Radiation Protection Adviser (RPA) has been appointed under Regulation 13 of the IRR99. The RPA has been provided with appropriate terms of reference. DLS is obliged to consult the RPA on those matters which are specified in Regulation 13(1) and Schedule 5 of IRR99. The RPA's name is listed in Appendix 1.
- 2.3 In these Local Rules, the term 'the Science Director' refers to the Life Sciences Director for Life Science beamlines and the Physical Sciences Director for Physical Science beamlines. The appropriate Science Director will authorise each successive phase of the commissioning for the beamlines, having received appropriate confirmation of the functioning of the PSS (Personnel Safety System), the integrity of the shielding, and that all appropriate procedures are in place. Names of the Science Directors are given in Appendix 1.
- 2.4 The Health Physics (HP) Team Leader has responsibility for overseeing all aspects of radiation safety. For those matters specified in Regulation 13(1) and Schedule 5

<b>Health Physics</b>		<b>Doc No: TDI-HP-LR-0002</b> <b>Issue: 9</b> <b>Date: 04<sup>th</sup> August 2015</b> <b>Page: 5 of 18</b>
Author: R Doull	Reviewed by: S Faruk	Issued on:

of IRR99, the Health Physics Team Leader must consult with the RPA. The name of the Health Physics Team Leader is given in Appendix 1.

- 2.5 Radiation Protection Supervisors (RPSs) have been appointed by the Science Director under Regulation 17 (4) of the IRR99. They are responsible for ensuring compliance with the Local Rules and have been given appropriate terms of reference. The Experimental Hall Coordinators have been appointed RPSs for the beamlines and their names and contact details are given in Appendix 1.
- 2.6 The Principal Personnel Safety Engineer (PPSE) is responsible for the design, commissioning, routine testing and modification of the beamlines' Personnel Safety System (PSS) as described in Section 6 and [TDI-HP-GEN-REP-0013<sup>1</sup>](#).
- 2.7 The Principal Beamline Scientist (PBS) has overall responsibility for the safe commissioning and operation of their beamline(s) and all associated equipment. This includes:
- Ensuring that the front end optics shutter is not opened at larger currents and higher magnetic field than the limits supplied by the RPA.
  - Ensuring that the procedures defined in the Local Rules and relevant Method Statements are followed.
  - Reviewing risk assessments submitted by Users.
  - Ensuring that all necessary safety equipment is supplied, including portable X-ray monitors at main entrances to all hutches.
  - Ensuring that any emergency exits are free from obstruction.
  - Before the start of each User's beam time, ensuring that an effective search of the hutch can be performed and that all warning signs and lights are operational.
  - Ensuring that all Users have been given suitable training and are competent to work on the beamline.
- 2.8 The Experimental Hall Manager is responsible for all operational aspects of safety in the Experimental Hall area. The Experimental Hall Manager must be informed of the intention to undertake hazardous operations within the DLS Experimental Areas, and has been authorised by the Science Director to halt any operation which they consider hazardous to personnel or equipment. The Experimental Hall Manager's name is given in Appendix 1.

### 3. [Dose Investigation Level](#)

- 3.1 If the dose recorded by any DLS employee exceeds 0.8 milliSieverts (mSv) for the first time in any calendar year, the Health Physics Team Leader will initiate a

<sup>1</sup>

[http://diamdocs/sites/default/TECHNICAL%20DIVISION%20\(TEC\)/Health%20Physics%20HP/General%20\(GEN\)/Reports%20\(REP\)/TDI-HP-GEN-REP-0013.pdf](http://diamdocs/sites/default/TECHNICAL%20DIVISION%20(TEC)/Health%20Physics%20HP/General%20(GEN)/Reports%20(REP)/TDI-HP-GEN-REP-0013.pdf)

<b>Health Physics</b>		<b>Doc No: TDI-HP-LR-0002</b> <b>Issue: 9</b> <b>Date: 04<sup>th</sup> August 2015</b> <b>Page: 6 of 18</b>
Author: RDoull	Reviewed by: SFaruk	Issued on:

formal investigation to make sure that exposure is being restricted as far as is reasonably practicable. The RPA must be consulted about this investigation.

- 3.2 If there is evidence to suggest that the dose received by any DLS employee may reach the investigation level before the end of the calendar year, the Health Physics Team Leader will initiate a review of working conditions with the aim of restricting further exposure before the investigation level is reached.

#### 4. Areas to Which These Rules Apply

- 4.1 These Local Rules apply within all the Controlled and Supervised Radiation Areas listed in Appendix 2. The designation of each area is shown at each entrance into the area.

#### 5. Shielding

- 5.1 The beamlines have been installed within interlocked shielded hutches. Some beamlines also make use of shielded transfer pipes between hutches. On some beamlines, the energy of the beam is sufficiently low that shielded hutches are not required. On these beamlines, the vacuum vessel forms the radiation shielding provided that the vacuum is maintained at the required pressure. These beamlines are under vacuum PSS. The PSS will close the beamline shutters if the pressure rises above a pre-determined level. The Health Physics Team will verify that the shielding is adequate by performing frequent radiation surveys. Once the equipment is operating normally, surveys will be performed on a 6 monthly basis. This period will be subject to review.

- 5.2 All removable radiation shielding and beamline components which have a radiation safety function, e.g. shutters and bremsstrahlung collimators, are subject to configuration control using a radiation Permit to Work (PtW) based on the DLS PtW procedure [HAS-PRC-0005](#)<sup>2</sup>. All such shielding and components or its covers will be painted yellow or provided with suitable signs to indicate that it is subject to configuration control, and that a radiation PtW issued by the RPS is required in order to disassemble the shielding or change or remove the components. The RPS will keep a register of all shielding and components which are subject to configuration control. User labyrinths are under PSS Fortress key control rather than configuration control – the beamline is disabled if the User labyrinth key is not in its key press.



Fig 1 Sample of warning sign for PtW.

<h1>Health Physics</h1>		<p>Doc No: TDI-HP-LR-0002  Issue: 9  Date: 04<sup>th</sup> August 2015  Page: 7 of 18</p>
Author: RDoull	Reviewed by: SFaruk	Issued on:

- 5.3 Any changes to radiation shielding or radiation safety critical components, whether intended to be permanent or temporary, must be carried out under a radiation PtW issued by the RPS.
- 5.4 For temporary changes to radiation shielding which has been designed and constructed to fit only in the correct manner, the RPS will visually confirm that the shielding has been returned to its original configuration before cancelling the permit. All other shielding must be surveyed by the Health Physics Team before the permit can be cancelled.
- 5.5 Permanent changes to radiation shielding and radiation safety critical components, or installation of new shielding, must be approved in advance by the RPA. The changes must be implemented under a radiation PtW issued by the RPS. The shielding or changed components must be surveyed by the Health Physics Team before the permit can be cancelled.
- 5.6 Where a survey is mandatory before a radiation PtW can be cancelled, it is permitted to open the shutter when machine running in its max current level specifically for the survey whilst the RPS and a member of the Health Physics Team are present.

## 6. Personnel Safety System (PSS)

- 6.1 It is probable that any person left in a hutch whilst the beam is on would suffer serious detriment to their health. A PSS is provided in all the hutches to ensure that people cannot be present in the hutches whilst the beam is about to be or is switched on in that hutch. The procedures for design and modification of a PSS is described in [TDI-HP-GEN-REP-0013](#)<sup>3</sup>. This document should be considered as part of the Local Rules.
- 6.2 **Disciplinary action** will be taken against any person -
  - 6.2.1 Tampering (i.e. altering or interfering in an unauthorised or improper manner) with any part of the PSS.
  - 6.2.2 Deliberately not performing a search of any hutch in the correct manner.

---

3

[http://diamdocs/sites/default/TECHNICAL%20DIVISION%20\(TEC\)/Health%20Physics%20HP/General%20\(GEN\)/Reports%20\(REP\)/TDI-HP-GEN-REP-0013.pdf](http://diamdocs/sites/default/TECHNICAL%20DIVISION%20(TEC)/Health%20Physics%20HP/General%20(GEN)/Reports%20(REP)/TDI-HP-GEN-REP-0013.pdf)

<b>Health Physics</b>		<b>Doc No: TDI-HP-LR-0002</b> <b>Issue: 9</b> <b>Date: 04<sup>th</sup> August 2015</b> <b>Page: 8 of 18</b>
Author: RDoull	Reviewed by: SFaruk	Issued on:

- 6.3 Deliberately locking a person inside an interlocked hutch is forbidden except for the purpose of checking the crash out mechanisms and PSS (including emergency beam off buttons). These checks must be done under a PSS PtW defined by the Principal Personnel Safety Engineer (PPSE) who will specify adequate hardware precautions to ensure that the beam cannot be activated in that hutch during the work.
- 6.4 The local RPSs are responsible for ensuring that an effective search pattern is maintained within the beamline hutches. Searchers must report to the RPS for the area any specific problems immediately for rectification.
- 6.5 Anybody noticing any fault or problem with the PSS for any beamline must not enter the hutch, and report to the Operations Shift Leader and PPSE as soon as possible.
- 6.6 Beamline users must not allow beam into the hutch if they are aware of any fault or problem with the PSS which would compromise the effectiveness of the search in excluding people from the area.

## **7. Access / Working Instructions**

- 7.1 All staff, Users and contractors entering the Controlled & Supervised Radiation Areas covered by these Local Rules are required to attend a Health Physics training session or online refresher training every 2 years dealing with the radiation hazards present around the beamlines and the contents of these Local Rules.
- 7.2 All staff, Users and contractors are required to obey all safety signs displayed at the doors of and inside the hutches.
- 7.3 General access to any commissioned, operational hutch is only permitted when the annunciator outside the door reads "Open". Personnel not performing a search must not attempt to enter a hutch when it is in the process of being searched, shown as "Restricted" on the annunciator. Only those personnel trained in operation of the beamline may initiate an entry to the hutch once it has been searched, shown as "Standby" or "Beam on" on the annunciator. Entries under these conditions will 'break the search', returning the annunciator to "Open", and another search will be required before operation can resume.
- 7.4 A portable X-ray radiation monitor will be located at each main entrance to all hutches. After breaking the search on an interlocked hutch, the first person entering the hutch must take this monitor with them, ensuring that it is switched on, and use it to check their work area.
- 7.5 The Ionising Radiations Regulations (IRR99) only allow two methods for access to a Controlled Radiation Area. Personnel must either be classified radiation workers, or must enter the area under a Written System of Work.
- 7.6 Classified Workers

<p><b>Health Physics</b></p>	 <p><b>diamond</b></p>	<p><b>Doc No: TDI-HP-LR-0002</b>  <b>Issue: 9</b>  <b>Date: 04<sup>th</sup> August 2015</b>  <b>Page: 9 of 18</b></p>
<p>Author: RDoull</p>	<p>Reviewed by: SFaruk</p>	<p>Issued on:</p>

7.6.1 All classified radiation workers employed by DLS are issued with personal dosimeters. These dosimeters should be worn for the period indicated on the dosimeter. Classified workers in the employment of another radiation employer who are visiting DLS (other than as outside workers) will have appropriate dosimetry issued by their employer. Classified workers must wear their dosimeters at any time that they enter any DLS Controlled or Supervised Radiation Areas. All classified workers employed by DLS will receive training in radiation safety before commencing work with radiation.

7.6.2 Classified workers have a duty of care to their dosimeter – information on use and care of dosimeters is provided to all workers when they become classified workers – see the DLS Health Physics leaflet “[Wear Your Dosimeter<sup>4</sup>](#)” available via the Health Physics pages of the Diamond Intranet.

## 7.7 Non-classified Workers

7.7.1 All non-classified workers must enter the Controlled Radiation Areas under the Written System of Work (Appendix 3). Some workers at Diamond have been chosen to be part of a ‘control group’. They are issued with personal dosimeters on a quarterly basis. The purpose of this practice is to ensure that Diamond’s working areas have been correctly designated for radiation protection purposes. All workers in the ‘control group’ must wear their dosimeters at any time that they enter any DLS Controlled or Supervised Radiation Areas. The Written System of Work still applies to these persons.

## 7.8 Outside Workers

7.8.1 Outside Workers are contractors providing a service to DLS, in DLS Controlled Radiation Areas, who have been designated as classified radiation workers by an employer other than DLS and who have a Radiation Passbook in their possession.

7.8.2 DLS employees who supervise potential outside workers must inform the Health Physics Team before the Outside Worker arrives at Diamond.

7.8.3 The Outside Worker must report initially to the Health Physics Team and present their Radiation Passbook. The Health Physics Team will retain the passbook whilst the Outside Worker is at DLS. The Outside Worker will be provided with dosimetry for the purpose of dose assessment.

7.8.4 The DLS RPS and the contractor’s supervisor must ensure that the Outside Worker is wearing all appropriate dosimetry before permitting access to the Controlled Radiation Area. A Written System of Work is not needed and the Outside Worker is considered to have the same status in terms of access as a DLS Classified Worker to those Controlled Radiation Areas agreed upon in writing between DLS and the Outside Worker’s Employer.

<sup>4</sup> <http://intranet.diamond.ac.uk/dms/DiamondDocs/HealthPhysics/Wear-your-dosimetry/Wear%20your%20dosimetry.pdf>

<p><b>Health Physics</b></p>	 <p><b>diamond</b></p>	<p><b>Doc No: TDI-HP-LR-0002</b>  <b>Issue: 9</b>  <b>Date: 04<sup>th</sup> August 2015</b>  <b>Page: 10 of 18</b></p>
<p>Author: RDoull</p>	<p>Reviewed by: SFaruk</p>	<p>Issued on:</p>

7.8.5 At the end of the work, the Outside Worker must report to the Health Physics Team to allow a dose estimate to be entered into his or her Radiation Passbook. The Health Physics Team will forward the assessed dose to the Outside Worker's employer as soon as possible. If it is known that Outside Workers will arrive or depart outside of normal working hours, the Health Physics Team will make special arrangements for the issue of dosimeters and entry of the dose estimate into the Outside Worker's Radiation Passbook. These arrangements will be agreed with the Outside Worker's employer.

## **8. Use of Radioactive Sources, Samples and X-ray Generators**

- 8.1 Detailed procedures covering the use of sources at DLS are given in the document "Use of Radioactive Sources at Diamond", [TDI-HP-PRC-0002](#)<sup>5</sup>. This document should be considered part of the Local Rules.
- 8.2 All radioactive sources and materials required by DLS staff must be purchased by the Health Physics Team. This may require application for an amendment to the Environmental Permit, which can take several months to be granted.
- 8.3 All persons intending to use DLS owned radioactive sources on the Diamond premises must provide copies of the method statements and risk assessments to the Health Physics Team Leader at least 5 working days before the work is intended to start.
- 8.4 Users must not bring radioactive material to DLS without prior agreement from the Health Physics Team Leader. Users intending to bring radioactive material to site must state this in their application for beam time. Radioactive material includes radioactive sources, experimental samples and Naturally Occurring Radioactive Materials (NORM). Copies of the risk assessments and method statements must be submitted to the Health Physics Team Leader at least 15 working days before the sources are required on site. The Health Physics Team Leader may refuse permission for certain radioactive materials to be brought onto site. Users wishing to work with any radioactive material on site, whether owned by their employer or by DLS, must provide a certificate from their employer indicating their competence to work with radioactive materials. Detailed procedures covering the use of user owned sources at DLS are given in the document "Procedures for the use of radioactive samples on the Diamond beamlines", [TDI-HP-PRC-0006](#)<sup>6</sup>.
- 8.5 No radioactive material or source, including activated components, may leave the DLS site without prior approval of the Health Physics Team Leader.
- 8.6 If the person responsible for a source knows or suspects it is missing or damaged, they should immediately inform the RPS, Experimental Hall Manager and the Health Physics Team.

<sup>5</sup> [http://diamdocs/sites/default/TECHNICAL%20DIVISION%20\(TEC\)/Health%20Physics%20HP/Procedures%20\(PRC\)/TDI-HP-PRC-0002.pdf](http://diamdocs/sites/default/TECHNICAL%20DIVISION%20(TEC)/Health%20Physics%20HP/Procedures%20(PRC)/TDI-HP-PRC-0002.pdf)

<sup>6</sup> [http://diamdocs/sites/default/TECHNICAL%20DIVISION%20\(TEC\)/Health%20Physics%20HP/Procedures%20\(PRC\)/TDI-HP-PRC-0006.pdf](http://diamdocs/sites/default/TECHNICAL%20DIVISION%20(TEC)/Health%20Physics%20HP/Procedures%20(PRC)/TDI-HP-PRC-0006.pdf)

<b>Health Physics</b>	 <b>diamond</b>	<b>Doc No: TDI-HP-LR-0002</b> <b>Issue: 9</b> <b>Date: 04<sup>th</sup> August 2015</b> <b>Page: 11 of 18</b>
Author: RDoull	Reviewed by: SFaruk	Issued on:

8.7 If any person intends to install or use X-ray generators on any beamlines, they must seek advice from the RPA in advance. They will need to obtain approval for the shielding and interlock systems, showing that they are not susceptible to being circumvented. X-ray generators used at Diamond must comply with the Generic Prior Authorisation for the Use of Electrical Equipment Intended to Produce X-rays, issued by the HSE.

## 9. Incidents, Accidents and Contingency Plans

9.1 The possibility of accidents and incidents involving ionising radiation or failure of the search system is small but cannot be eliminated totally.

9.2 Any person finding themselves to be locked in a searched hutch should walk towards the nearest door avoiding crossing the X-ray beam if possible, and pressing the nearest emergency beam off button en route or pressing the emergency door release. They must then report to the Operations Shift Leader in the Control Room. The Operations Shift Leader will inform a Science Director who will decide what form of investigation, if any, will be conducted.

9.3 A contingency plan (Appendix 4) has been written to cover reasonably foreseeable accidents involving persons being exposed to radiation.

9.4 Any person hearing the fire alarm sounding must follow DLS FIRE AND EMERGENCY ARRANGEMENTS ([HAS-PRC-0011<sup>7</sup>](#)).

## 10. General

### 10.1 Radiography

All DLS staff who intend to bring radiography contractors onto the Diamond site must inform the Health Physics Team Leader (who will inform the Experimental Hall Manager and the RPS) at least 5 working days before the work is intended to start.

<sup>7</sup> <http://diamvdocs13.diamond.ac.uk/HEALTH%20AND%20SAFETY/Documentation/Procedures/HAS-PRC-0011.doc>

<b>Health Physics</b>		<b>Doc No: TDI-HP-LR-0002</b> <b>Issue: 9</b> <b>Date: 04<sup>th</sup> August 2015</b> <b>Page: 12 of 18</b>
Author: RDoull	Reviewed by: SFaruk	Issued on:

## Appendix 1 – Names of Nominated People

Position	Name	Tel Ext.
Science Director (Physical Sciences)	Professor Trevor Rayment	8984
Science Director (Life Sciences)	Professor David Stuart	8877
RPA & HP Team Leader	Richard Doull	8269
Experimental Hall Manager	Jean Lane	8642
Principal Personnel Safety Engineer	Martin Wilson	8049
RPSs: All Experimental Hall Coordinators (EHCs) as listed below have been appointed RPSs:		
	EHC General Number	8787
	Edward Cassidy	8738
	Leslie Clinker	8737
	Alistair Donaldson	8751
	Nicholas Gorringe	8732
	Douglas Scott	8724
	Nathan Sear	8733
	Paul Symes	8731
Operations Shift Leader	Control Room	8899 (01235 778899 from a mobile phone)

## Appendix 2 – Designation of Areas

Designation	Area
Controlled Radiation Area	All commissioned beamline hutches which are shielded and protected by a Personnel Safety System. (Including beamline hutches in the I13 external building)
Supervised Radiation Area	Experimental area floor bounded by the outer circulation corridor.
Not designated	All other areas.

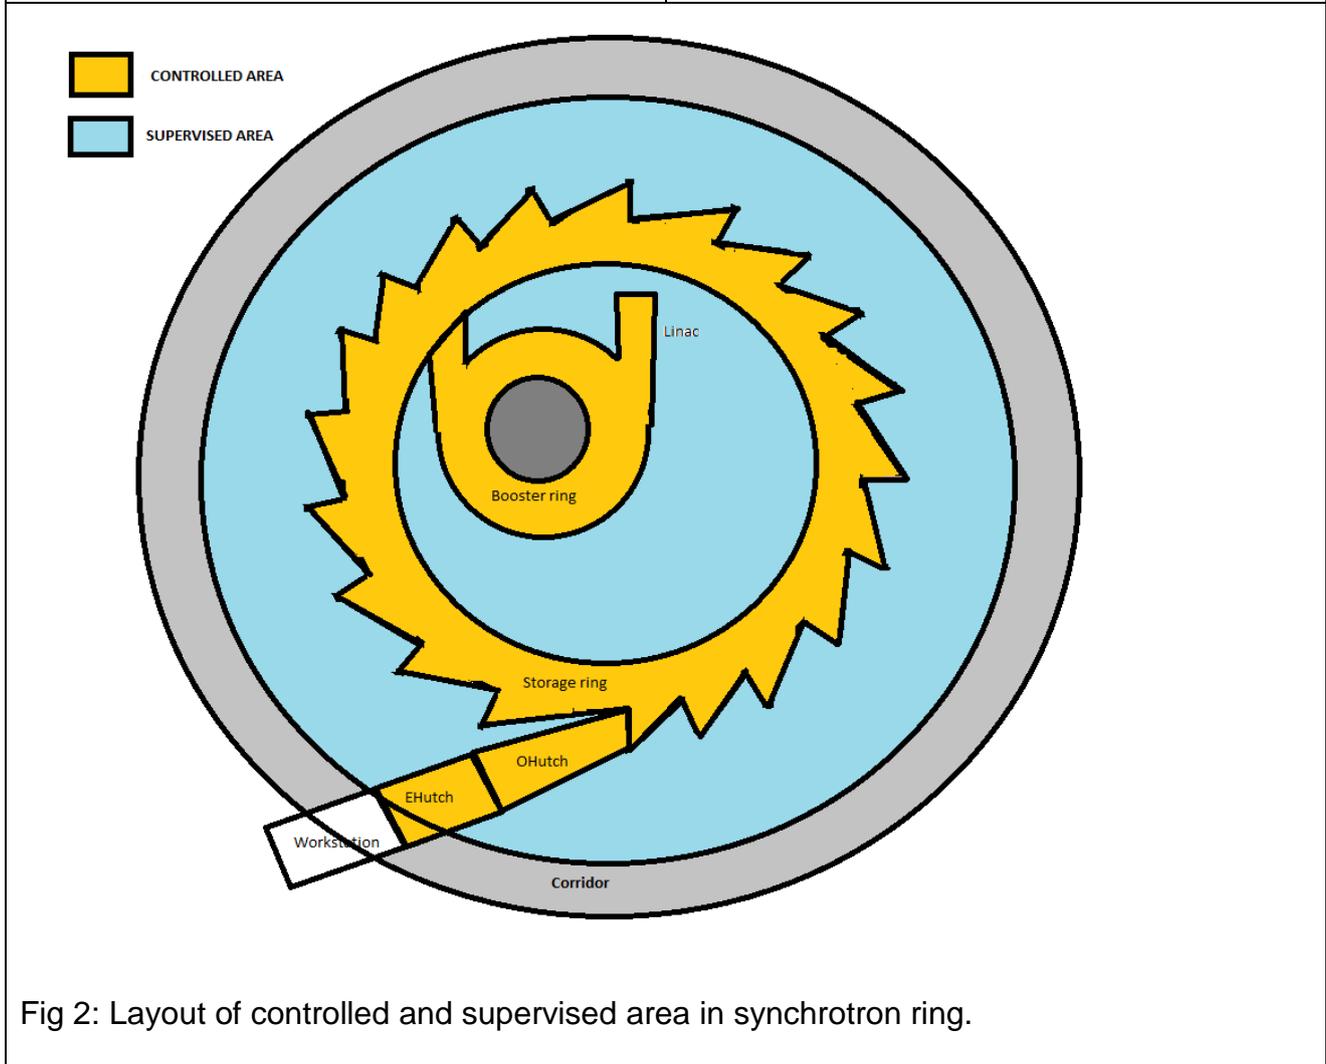


Fig 2: Layout of controlled and supervised area in synchrotron ring.

<b>Health Physics</b>		<b>Doc No: TDI-HP-LR-0002</b> <b>Issue: 9</b> <b>Date: 04<sup>th</sup> August 2015</b> <b>Page: 14 of 18</b>
Author: RDoull	Reviewed by: SFaruk	Issued on:

## Appendix 3 – Written System of Work for access to the DLS Controlled Radiation Areas by Non-classified Persons

### 1. Area

This Written System of Work (WSoW) applies to work within the beamline hutches and any other temporary Controlled Radiation Areas.

### 2. Application

This WSoW applies to ALL people entering the above areas who are not designated as Classified Workers under Regulation 20 of the Ionising Radiations Regulations 1999.

### 3. Summary of Hazards

#### 3.1 Optics hutches (Controlled Area):

When the accelerators are operating and shutters open, the Optics hutches will take synchrotron radiation and bremsstrahlung. The synchrotron radiation is a high intensity beam with energy in the tens of keV range, whereas the bremsstrahlung is lower intensity but more penetrating, having an energy spectrum up to 3 GeV. Prior to taking beam, the hutches will be searched and locked by trained DLS staff. The Optics hutches are shielded with lead. Sensitive gamma radiation monitors which continuously monitor and record dose rate are installed on the outer wall of the Optics hutch, opposite the first scattering element.

#### 3.2 Experiments Hutches (Controlled Area):

When the accelerators are operating and shutters open, the majority of Experiments hutches will take synchrotron radiation only, the bremsstrahlung having been stopped in the Optics hutch. The radiation will be scattered within the hutch. Prior to taking beam, the hutches will be searched and locked by trained DLS staff or Users. The Experiments hutches are shielded with lead, concrete or steel. The Experiments hutches on beamlines which are capable of taking bremsstrahlung are shielded as Optics hutches.

#### 3.3 Radioactive sources:

The radioactive sources permitted for use on the beamlines are limited to those covered by DLS's Environmental Permit. An appropriate Risk Assessment will be completed prior to the use of any radioactive source on a beamline and a copy submitted to the RPA, giving a minimum of 5 working days' notice. Users require to

<b>Health Physics</b>	 <b>diamond</b>	<b>Doc No: TDI-HP-LR-0002</b> <b>Issue: 9</b> <b>Date: 04<sup>th</sup> August 2015</b> <b>Page: 15 of 18</b>
Author: RDoull	Reviewed by: SFaruk	Issued on:

use Radio-chemical Lab will also need to follow the Radio-chemical Lab local rules [TDI-HP-LR-0006](#)<sup>8</sup>.

## 4. Access Conditions

### 4.1 General

4.1.1 Access to any hutch is only permitted when the annunciator outside the door reads “Open”. Personnel must not attempt to enter a hutch when it is in the process of being or has been searched, shown as “Restricted” or “Standby” respectively on the annunciator.

4.1.2 A portable X-ray monitor is located at each main entrance to all hutches. The first person to enter the hutch after it has taken beam must take this monitor with them, ensuring that it is switched on.

### 4.2 DLS Employees

4.2.1 All DLS staff, Users or contractors who “work” or accompany visitors in the hutches are expected to attend a training course in basic radiation safety. This will explain the requirement of:

- The Local Rules
- Permits to Work
- Shielding
- The meaning of any signs in use
- Emergency Procedures
- Access

### 4.3 Visitors

4.3.1 Visitors are people entering the Diamond Controlled and Supervised Radiation Areas (fig 2) who spend less than 4 hours in any week in the radiation areas and can be DLS staff, contractors, students, schoolchildren and members of the public etc. These visits allow people to view the beamlines, take simple data/measurements, collect equipment etc. Anyone entering the radiation areas for longer than this time limit is classed as “working”.

4.3.2 All visitors must be accompanied at all times by a member of DLS staff who has; attended a radiation safety training session, is fully aware of the work in progress in the area and the contingency plan detailed in Appendix 4 of this document.

4.3.3 In Supervised Radiation Areas the maximum number of visitors is 10 per Suitably Qualified and Experienced DLS staff. Maximum number of visitors in a tour group is

<sup>8</sup> [http://diamvdocs13.diamond.ac.uk/TECHNICAL%20DIVISION%20\(TEC\)/Health%20Physics%20HP/Local%20Rules%20\(LR\)/TDI-HP-LR-0006.pdf](http://diamvdocs13.diamond.ac.uk/TECHNICAL%20DIVISION%20(TEC)/Health%20Physics%20HP/Local%20Rules%20(LR)/TDI-HP-LR-0006.pdf)

<p><b>Health Physics</b></p>		<p><b>Doc No: TDI-HP-LR-0002</b>  <b>Issue: 9</b>  <b>Date: 04<sup>th</sup> August 2015</b>  <b>Page: 16 of 18</b></p>
<p>Author: RDoull</p>	<p>Reviewed by: SFaruk</p>	<p>Issued on:</p>

12 depending on the profile of the group, tour groups of more than 10 visitors must be accompanied by at least 2 Suitably Qualified and Experienced Persons. Authorisation must be obtained from the appropriate person in charge of that area. The host (DLS staff) is responsible for ensuring the evacuation of the visitors in the event of a fire.

4.3.4 In Controlled Radiation Areas the maximum number of visitors is 6 per Suitably Qualified and Experienced Person. Maximum number of visitors in a tour group is 12, tour groups of more than 6 visitors must be accompanied by at least 2 Suitably Qualified and Experienced DLS staff. Authorisation must be obtained from the appropriate person in charge of that area. The host (DLS staff) is responsible for ensuring the evacuation of the visitors in the event of a fire.

4.3.5 Visitors must obey all safety signs displayed at the door, inside the hutches and all instructions given by the guide.

#### 4.4 Contractors.

4.4.1 All contractors who “work” on the beamlines are expected to attend radiation safety training or receive instruction (Tool box talk) in radiation safety. This will explain the requirement of:

- Requirements of the Local Rules
- Permits to Work
- Shielding
- The meaning of any signs in use
- Emergency Procedures
- Access

#### 4.5 Special Cases

4.5.1 Female employees and visitors: The external radiation hazards around the hutches are expected to be low, so it is not considered necessary to introduce further work restrictions for female workers or visitors who may be pregnant. This must however, be confirmed by risk assessment. Any female employee who declares herself to be pregnant will be offered a personal dosimeter on a monthly basis for the term of the pregnancy. A user who declares herself pregnant will be issued with a dosimeter for the duration of her time on the beamline. There are no significant contamination hazards around the hutches, so it is not considered necessary to introduce additional restrictions for female workers or visitors who may be breastfeeding (although there could be other reasons). They are advised to–

- Do not enter in the hutch first to do the radiation checks with radiation monitor (ask someone to do it)
- No work/ manipulation / handling with radioactive or induced materials.

4.5.2 Young Persons on work experience: Young people aged between the ages of 16 and 18 are allowed to work as trainees in radiation areas subject to a risk

<b>Health Physics</b>	 <b>diamond</b>	<b>Doc No: TDI-HP-LR-0002</b> <b>Issue: 9</b> <b>Date: 04<sup>th</sup> August 2015</b> <b>Page: 17 of 18</b>
Author: RDoull	Reviewed by: SFaruk	Issued on:

assessment being performed by the person responsible for the visit and an annual dose limit of 0.3 milliSieverts.

## 5. Dose Estimation

- 5.1 Dose estimation will be derived from:
- Diamond Synchrotron Light Source. Report of the Design Specification. Volumes 1 and 2, chapter E6
  - [TDI-HP-GEN-PRO-0003<sup>9</sup>](#) Implementation of the Radiation Safety Legislation at Diamond
  - Installed radiation monitoring
  - Personal monitoring of classified workers and DLS control group
  - Radiation Surveys
  - Induced activity surveys
- 5.2 The shielding around Diamond has been designed to ensure that no person working outside of the shielding at DLS should receive a dose in excess of 1 milliSievert in a 2000 hour working year.

## 6. Records

- 6.1 The Approved Dosimetry Service contracted by DLS keeps all dose records.

## 7. Contingencies

- 7.1 All persons working in the hutches must be aware of the contingency plans for dealing with emergencies, detailed in Appendix 4 of this document.

<sup>9</sup> [http://diamdocs/sites/default/TECHNICAL%20DIVISION%20\(TEC\)/Health%20Physics%20HP/General%20\(GEN\)/Proposals%20\(PRO\)/TDI-HP-GEN-PRO-0003.pdf](http://diamdocs/sites/default/TECHNICAL%20DIVISION%20(TEC)/Health%20Physics%20HP/General%20(GEN)/Proposals%20(PRO)/TDI-HP-GEN-PRO-0003.pdf)

<b>Health Physics</b>	 <b>diamond</b>	<b>Doc No: TDI-HP-LR-0002</b> <b>Issue: 9</b> <b>Date: 04<sup>th</sup> August 2015</b> <b>Page: 18 of 18</b>
Author: RDoull	Reviewed by: SFaruk	Issued on:

## Appendix 4 – Contingency Plan for Persons Exposed to Radiation within a Hutch

The Operations Shift Leader on duty is responsible for activating and applying the emergency plan. This plan addresses the situation where someone has received or it is thought possible to have received, an over-exposure to radiation by being within a hutch whilst that beamline's shutter has been open. Any person who knows or suspects that they or another person has been over-exposed to radiation should contact the Operations Shift Leader in the Control Room immediately.

1. If a beamline beam off button has not already been pressed, press one immediately.
2. Disable the beamline by removing the beamline PSS key. Do not issue the key again until authorised in writing by the Science Director in conjunction with the RPA.
3. **Take whatever immediate action is needed to sustain life.** There should be no radiation hazard within the hutch although other hutches may still be taking beam. This should be confirmed using a switched on portable radiation monitor.
4. Do not leave the casualty unattended unless it is absolutely necessary to do so.
5. Summon assistance. Call a Diamond First Aider and the ambulance service (via RAL Security) on extension 2222, or 01235 778888 from a mobile phone. The John Radcliffe (JR) hospital in Oxford is the local Accident and Emergency hospital, although the ambulance crew will decide upon where to take the casualty.
6. Collect and record as much information as possible about the incident from the person concerned, and anyone else present.
7. If the emergency services have been called, ensure that the responders are met and escorted to the casualty.
8. A member of staff may accompany the casualty to hospital, during office hours this could be preferably be the RPS. JR is the nearest A&E and has radiation emergency procedure in place. Out of office hours the EHCs (who are all trained as RPSs) should ring JR via switch board (01865 741841) to alert emergency physicist/ RPA regarding the incident and seek their assistance.
9. Inform the Science Director, Human Resources (HR) and the Health Physics Team Leader, as soon as possible. HP team leader or RPA may communicate with Oxford University Hospitals (OUH) RPA or emergency physicist via switch board (01865 741841) if required.
10. Collect any dosimeters worn by the affected persons.
11. If the injuries are serious, arrange for Human Resources Group to inform both the casualty's employer (if not a staff member) and the casualty's next of kin.

This contingency plan is intended to cover only the emergency phase of the incident. The plan will end when the Operations Shift Leader has formally declared the situation safe and is satisfied that in the short term a repetition of the incident is not possible. The Science Director(s) will then decide if an inquiry should be established to investigate the incident.